CTI华测检测

Test Report



Report No.A223006571810102Page 1 of 5Company Name
Shown on ReportGradConn LtdAddress209 Minsheng Road, Longtan District, Taoyuan City, Taiwan 32554

The following sample(s) and sample information was/were submitted and identified by/on the behalf of the client

| Sample Name | Stainless Steel SMA Right Angle Bulkhead Jack | Stainless Steel SMA Right Angle Bulkhead Jack |
|------------------------|--|--|
| Туре | RFPC-SMA22-FN-A-E | RFPC-SMA22-FN-A-S |
| Sample Receiving State | Normal | Normal |
| Sample Received Date | Feb. 22, 2023 | |
| Testing Period | Feb. 22, 2023-Mar. 7, 2023 | |

Test Requested

| No. | Test Item |
|-----|-----------|
| 1 | ІРХ9К |

Test Result(s): Please see the following pages.

| Approved by Roger Diao | Date Mar. 7, 2023 |
|---|---|
| Roger xiao Roger xiao Signatory Suffernational Group Co., Ltd. | No. R372C759BB Hongwei Industrial Zone, Bao'an 70 District, Shenzhen, Guangdong, China |




Report No. A223006571810102

Page 2 of 5

Tested Sample(s)

| Sample No. | Sample Name | Туре | Quantity |
|-------------------|---------------------------|-------------------|----------|
| A2230065718101001 | Stainless Steel SMA Right | RFPC-SMA22-FN-A-E | 1pc |
| | Angle Bulkhead Jack | | |
| A2230065718101002 | Stainless Steel SMA Right | RFPC-SMA22-FN-A-S | 1pc |
| | Angle Bulkhead Jack | | |

Sample Photo(s)

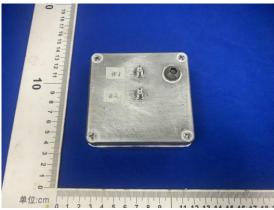

A2230065718101001~A2230065718101002



Report No. A223006571810102

Test Item: IPX9K

1. Test Equipment

| Equipment Name | Model |
|--|--------|
| IPX9 waterproof rating testing machine | JX1207 |

2. Environmental Conditions

Temperature:22.5°C; Humidity:45%RH

3. Test Standard: ISO 20653:2013

4. Test Condition

The water temperature:80 $^\circ\!\mathrm{C}$

Water flow:15L/min

Rotary speed:5r/min

Test Angle:0 °,30 °,60 °,90 ° respectively

Water spraying distance:100mm~150mm

Test time: Test each Angle for 30s

5. Test Result(s)

| Sample No. | Criterion | Test Results(Visual inspection) | Conclusion | |
|---|-----------------------------------|-----------------------------------|------------|--|
| A2230065718101001 | No water enters inside the sample | No water enters inside the sample | Pass | |
| A2230065718101002 | | No water enters inside the sample | Pass | |
| Remarks: The judgment basis is provided by the customer | | | | |

Page 3 of 5

たい という 用 Service



Report No. A223006571810102

Test Photo(s)




A2230065718101001~A2230065718101002 0°



A2230065718101001~A2230065718101002 30°



A2230065718101001~A2230065718101002 60 °

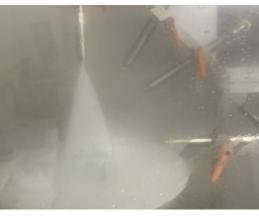

A2230065718101001~A2230065718101002 90°

Sample Photo(s) after the test



A2230065718101001~A2230065718101002

A2230065718101001~A2230065718101002

A WA A

Page 4 of 5



Report No. A223006571810102

Remark: The testing data and result(s) in this report is(are) just for scientific research, education, internal quality control and product development etc.

Statement:

- 1. This report is considered invalid without approved signature, special seal and the seal on the perforation;
- 2.Company Name and Address shown on Report, the sample(s) and sample Information was/were provided by the applicant who should be responsible for the authenticity which CTI hasn't verified;
- 3. The result(s) shown in this report refer(s) only to the sample(s) tested;
- 4. Without written approval of CTI, this report can't be reproduced except in full;
- 5.In case of any discrepancy between the English version and Chinese version of the testing reports (if generated), the Chinese version shall prevail.

*** End of Report ***

Page 5 of 5